




# Etekcity Lasergrip 1080 Battery Connector Replacement

If the device is not powering on and the battery is not the problem, it may be the battery connector.

Written By: Patrick Crawford

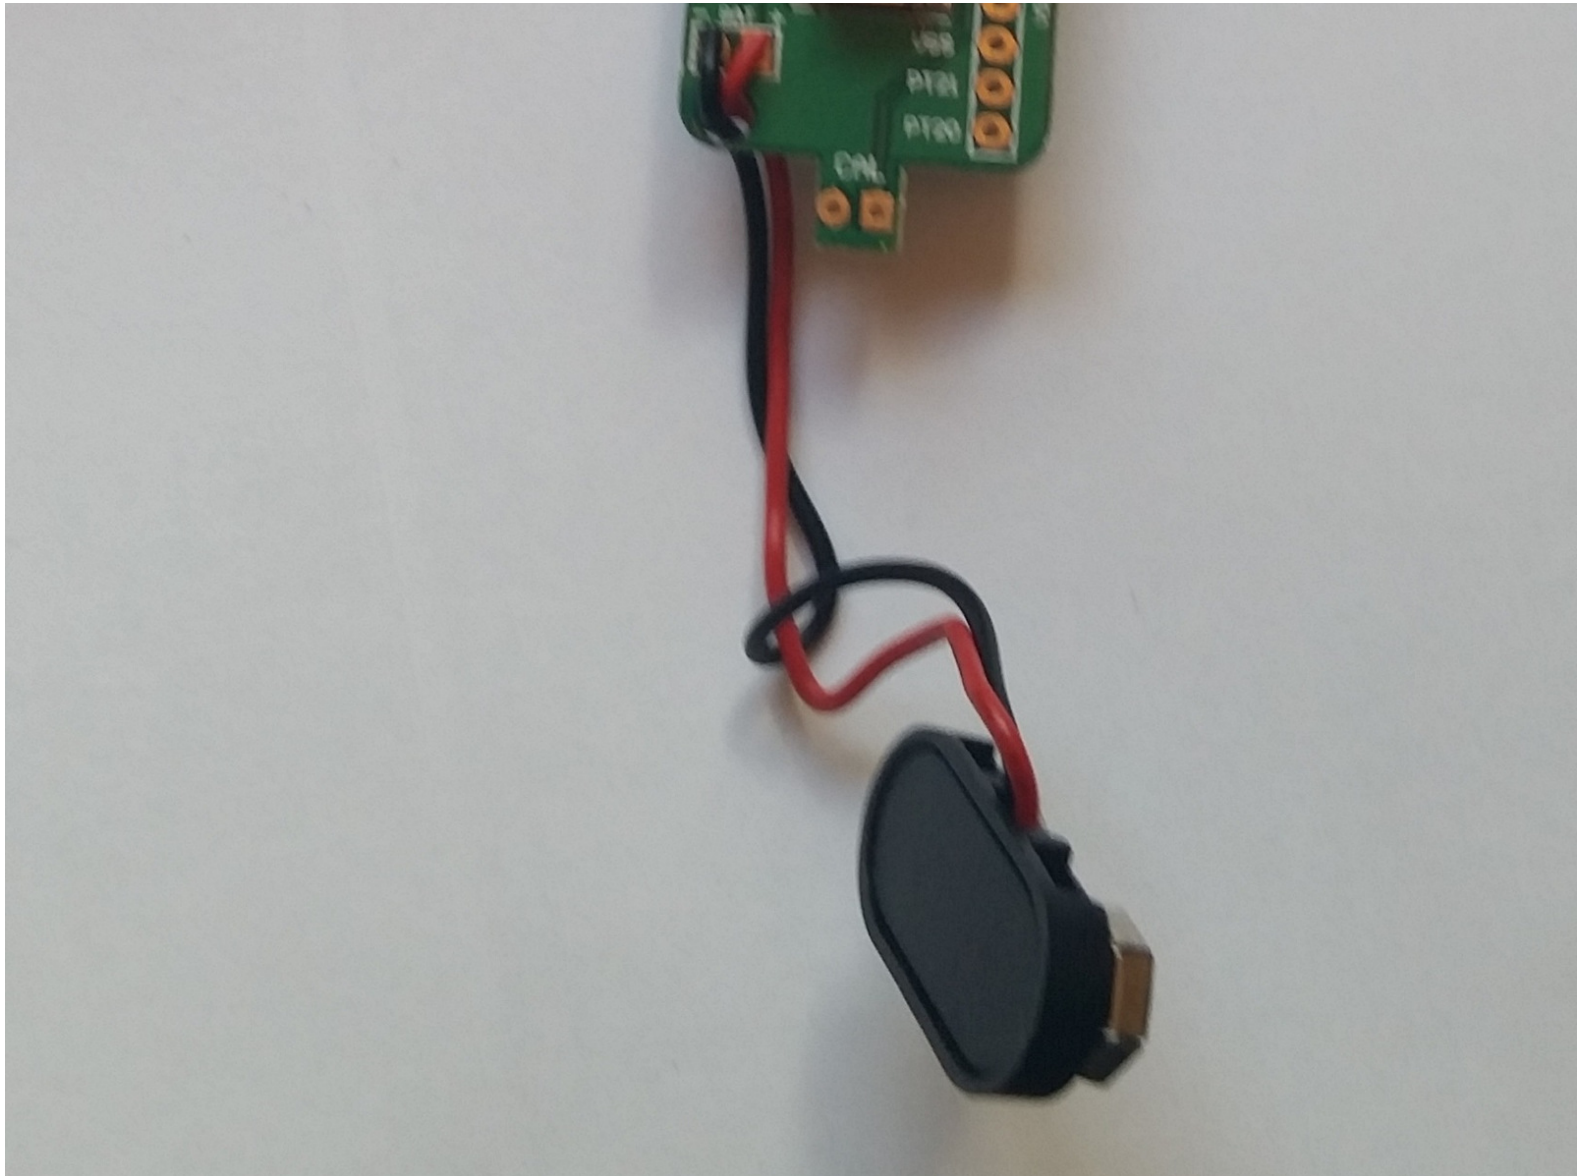

## INTRODUCTION

This guide will show you how to replace the battery connector. This replacement is necessary if a new battery is installed and the device still won't work or if the wires break. This will use a screwdriver and a soldering iron. Be careful when using the soldering iron as it is very hot. There is a link to a soldering guide in the Troubleshooting section of the device page.

---



### TOOLS:

- [Soldering Station](#) (1)
  - [Phillips #0 Screwdriver](#) (1)
  - [iFixit Opening Tools](#) (1)
-

## Step 1 — Battery



- Pull the battery cover away from the handle by gripping near the thumb groove.

## Step 2



- Gently pull the battery out of the handle.

⚠ Excessive force could damage wires.



## Step 3



- Disconnect the battery by pulling the connector away from it.

- Positive first
- Negative second

⚠ When replacing the battery, this order is reversed.

## Step 4 — Buttons



- Remove the battery cover from the device by pulling it straight out.

## Step 5



- Using the plastic opening tool remove the front and rear yellow covers.

⚠ When removing the back cover, be careful not to lose the buttons as they are not connected.


## Step 6



- Remove the two 3.1 mm Phillips #0 screws.




## Step 7

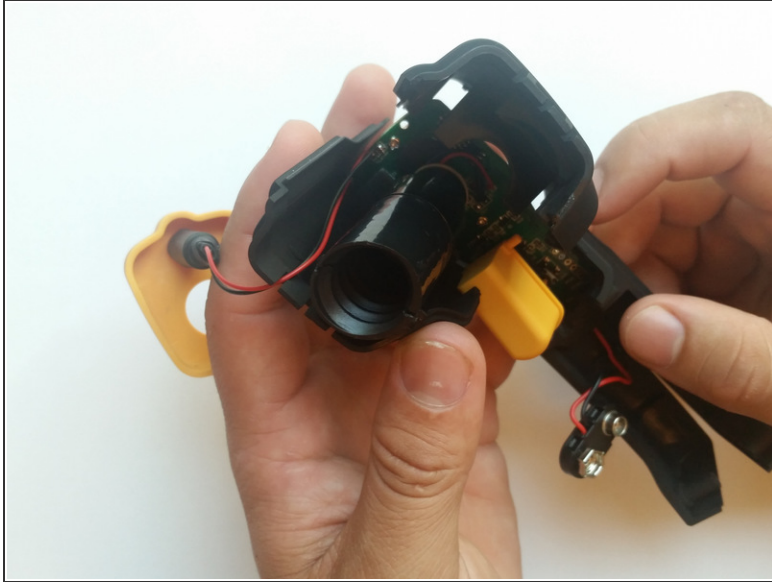

- Pull the two halves apart.



⚠ Be careful not to lose any components on the inside.

## Step 8

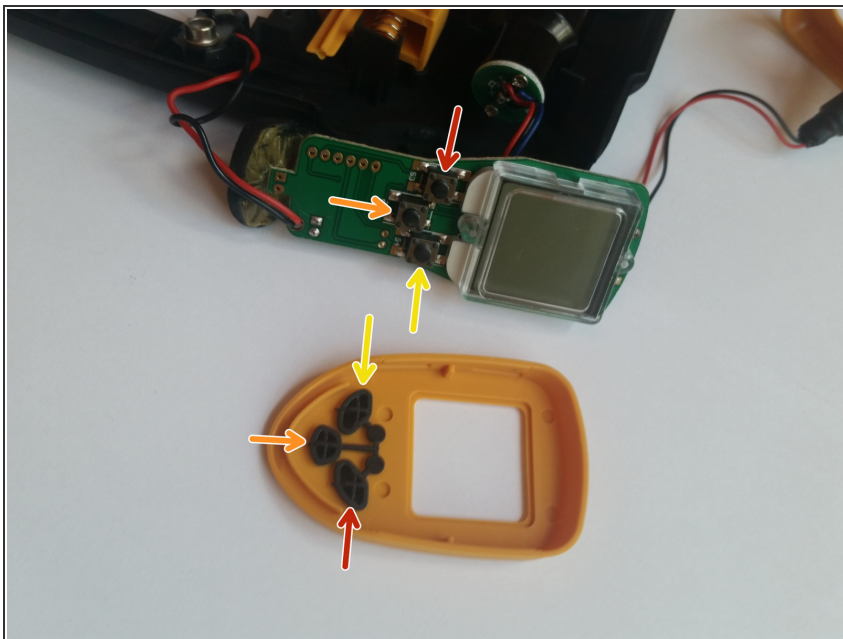

- Realign the buttons with the button terminals.
- Red terminal to red button.
- Orange terminal to orange button.
- Yellow terminal to yellow button.


## Step 9 — Etekcity Lasergrip 1080 Trigger Replacement

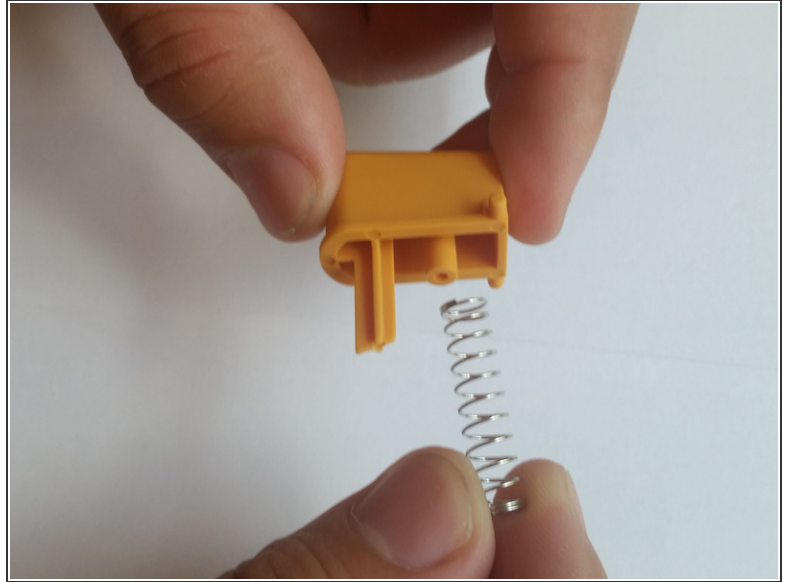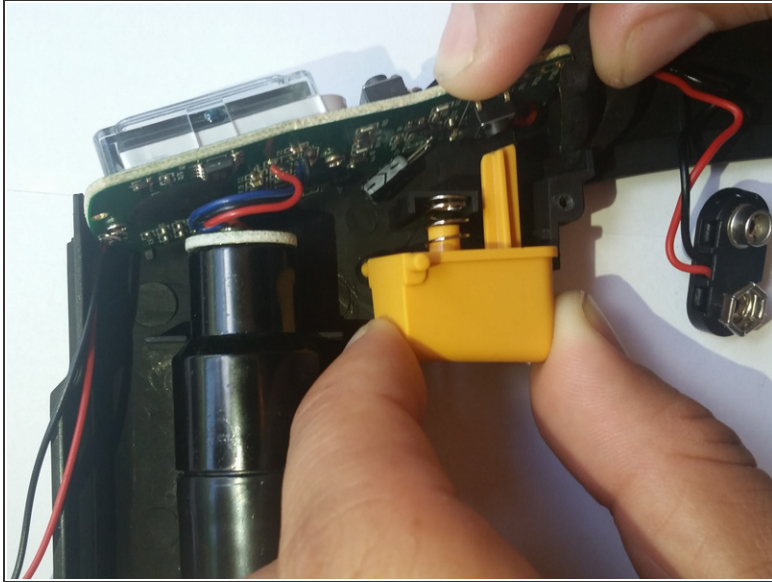

- Carefully pull the trigger out.


- ⚠ The trigger is spring loaded, so be careful that you do not lose the spring as you pull the trigger out.
- ℹ To put the trigger back in, align the peg with the hole in the handle and align the shaft with the button terminal.

## Step 10 — Battery Connector

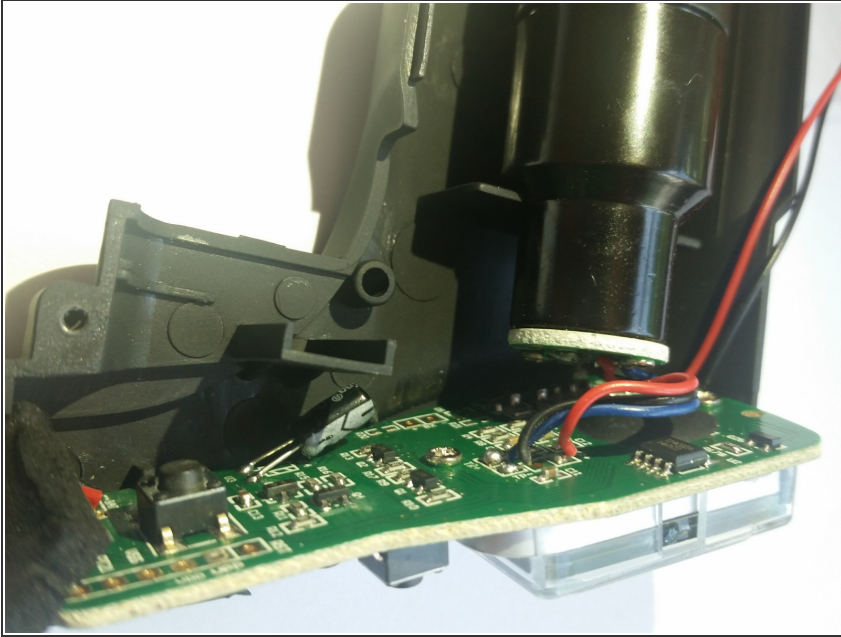

- Pull the motherboard out of its slot in the device.

## Step 11

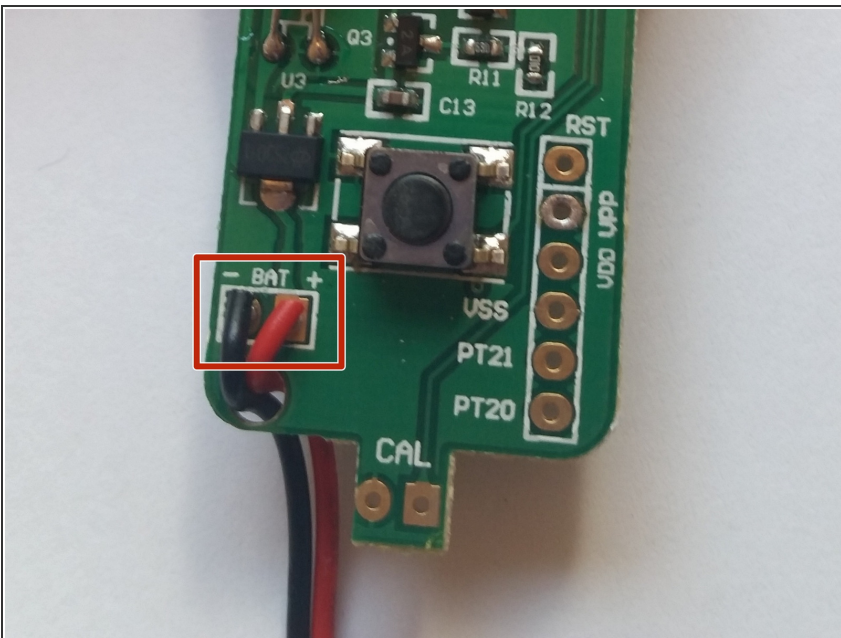

- Use a soldering iron and melt the solder where the battery connector's wires are attached to the motherboard.

⚠ Soldering irons are hot and should only be handled by those who know what they are doing and are wearing proper safety equipment. There is a link to a soldering guide in the Troubleshooting section of the device page.

To reassemble your device, follow these instructions in reverse order.